



Private Vehicle Inspection Report

Decal Number: GK84316
Decal Expiry Date: 2026-Oct-31
Inspection Number: 21548603

Inspection Result:
PASS

FACILITY: J. KAM AUTO REPAIR LTD, / S6203 INSP. TYPE: Complete INSP. START: 2025-Oct-23 10:30 AM PDT
INSPECTOR: Dhaliwal, Jarnail Singh / 105512 INSP. CLASS: Class 1 - Light Vehicle with LGVW INSP. COMPLETE: 2025-Oct-29 07:10 AM PDT
WORK ORDER #: 65412 INSP. REASON: Salvage Vehicle COLL. REP. FACILITY: Red Seal Collision LTD
COLL. REP. PHONE: (604) 753-8571
COLL. REP. TECHNICIAN: Mahmoud Haghmohammadi 01351-AB-08

VEHICLE JUR: British Columbia REGI: 12502736 VIN: 1FMCU9GD9JUA01040
PLATE #: XP509J UNIT/FLEET#: OWNER/LESSEE NAME: RAMOS, CARTASTIC RIDES LTD
LICENCED GVW(kg): 0 BODY STYLE: 4 Door Stationwagon ADDRESS: 5925 200A ST
VEHICLE YEAR: 2018 ODOMETER: 280621 KM Langley, British Columbia
MAKE: FORD HUB ODOMETER: V3A 6R2, Canada
MODEL: ESCAP BRAKE TYPE: Hydraulic
FUEL TYPE:

Vehicle Identification (VIN)	Passed
Section 1 - Power Train	Passed
Section 2 - Suspension	Passed
Section 3 - Brake System	Passed
Section 3H - Hydraulic Brakes	Passed
Section 4 - Steering	Passed
Section 5 - Instruments and Auxiliary Equipment	Passed
Section 6 - Lamps	Passed
Section 7 - Electrical System	Passed
Section 8 - Frame and Body	Repaired (same day) Rplcd frnt bmpr asmbly,rad sup,rad,a/c
Section 9A - Tires	Passed
Section 9B - Wheels	Passed
Section 10 - Coupling Devices	Not Applicable
Section 11 - Other Vehicle Components	Not Applicable

Tire Tread Depth (mm)						Brake Lining/Pad (mm)			Rotor Thickness or Drum Inside Diameter (mm)		
Axles	Outer L	Inner L	Inner R	Outer R	Steering	Lining/Pad	Left	Right	Rotor/Drum	Left	Right
1	5			5	✓	Pad	8	8	Rotor	25.20	25.20
2	5			5		Pad	8	8	Rotor	11.60	11.60
Comment:						Comment:			Comment:		

Inspection Comments: Repaired by Ramos Motors 778-708-2884 insp by j kam auto repair 604-591-1531
Has this Vehicle been road tested? Yes Road Test Date: After Inspection Road Tester: Mahmoud Haghmohammadi
Inspector: Dhaliwal, Jarnail Singh Signature:

This Inspection Report was submitted to CVSE on 2025-Oct-29 02:58 PM PDT.
The Inspector's signature above is certification that this vehicle has been inspected to the requirements of the Motor Vehicle Act and Regulations.

NOTICE: KEEP THIS VEHICLE INSPECTION REPORT WITH VEHICLE REGISTRATION.

The personal information collected on this form is collected under the authority of section 216 of the Motor Vehicle Act and Division 25 of the Motor Vehicle Act Regulations. It is collected for the purpose of processing this vehicle inspection and for generally administering the Vehicle Inspection Program and the National Safety Code (e.g. regulating carriers, authorized inspectors, and designated inspection facilities). If you have any questions about the collection of this information, you may contact the Sr. Manager, NSC/VIP at the Commercial Vehicle Safety Enforcement.

CVSE0013

10/29/2025 2:58:38 PM PDT



BRITISH
COLUMBIA

Ministry of Transportation
and Infrastructure

Body Integrity Inspection Report

To be completed by the Designated Inspection Facility's Authorized Vehicle Inspector

Designated Inspection Facility Information

Designated Inspection Facility Number

S 6 2 0 3

Authorized Inspector Number

1 0 5 5 1 2

DIF Facility Name

J. Kam Auto Repair LTD.

Inspector Name

Jarnail S. Dhaliwal

Inspection Start Date

Inspection Completion Date

23 10 2025 10 2025

Inspector Signature

[Signature]

VEHICLE OWNER

NAME OF REBUILDER (if other than owner)

Name

Catapultic Rule Htd.

Name

Ramsey Motors.

Address

5925 200a st.

Address

105 20081 Industrial av.

City

langley Prov BC PC V3A6R2

City

langley Prov BC PC V2Y3X6

Tel #

778-708-2884

Tel #

778-708-2884

Vehicle Information

TYPE OF VEHICLE:

☐ Passenger Car

☒ MPV

☐ Truck

☐ Motorhome

☐ Taxi

☐ Bus

Licence Plate

Odometer

28021

Year

2018

Make

ford

Model

escape.

Registration Number

12S02736.

VIN/Serial #

1FMCU9GP9JUA01040

I am satisfied that this rebuilt motor vehicle is the same as the one described in the record of rebuilding.

☒ Yes

☐ No

Requirements of Rebuilding		Components	R	C	VIM Reference Section	Components	R	C	VIM Reference Section
Photographs prior to rebuilding clearly showing vehicle damage	☒ Yes	STRUT				REAR STRUT TOWER			8 - 4 (b)
		- Left			8 - 4	- Left			
		- Right				- Right			
Structural Integrity Declaration Report	☒ Yes	HINGE (A) PILLAR				BUMPERS (Front/Rear)			8 - 5
		- Left			8 - 19	CROSSMEMBER			8 - 3 (c)
		- Right				HOOD			8 - 1
4 Wheel Alignment Printout	☒ Yes	CENTRE (B) PILLAR				RAD SUPPORT			
		- Left			8 - 19	BODY			8 - 2
		- Right				FRAME			8 - 3
Welded and structural components that require protection have been protected as required by OEM or I-CAR standard.	☒ Yes	LOCK (C) PILLAR				BULKHEAD (cowl)			
		- Left			8 - 19	DOORS			8 - 6
		- Right				QUARTER PANELS			8 - 2 (c)
Vehicle meets symmetric and asymmetric specifications as indicated on the Structural Integrity Declaration Report.	☒ Yes	ROCKER PANEL				- Left			
		- Left			8 - 19	- Right			
		- Right				FLOOR PAN			8 - 4 (a)

"R" marked when item rejected

"C" marked when item corrected

I certify that this rebuilt vehicle meets all Structural Integrity requirements as defined in the Motor Vehicle Act Regulations and the BC Vehicle Inspection Manual.

Authorized Inspector Name (print)

Jarnail S. Dhaliwal

Signature

[Signature]

J KAM AUTOMOTIVE
#217 12745 78AVE
SURREY, BC
604.591.1531

Customer: ramos

License No:

Order No.:

Date: 10/29/2025 10:30


Company:

Odometer: 028021

VIN: 1FMCU9GD9JUA01040

Technician: jk

Vehicle FORD 2018 ESCAPE AWD

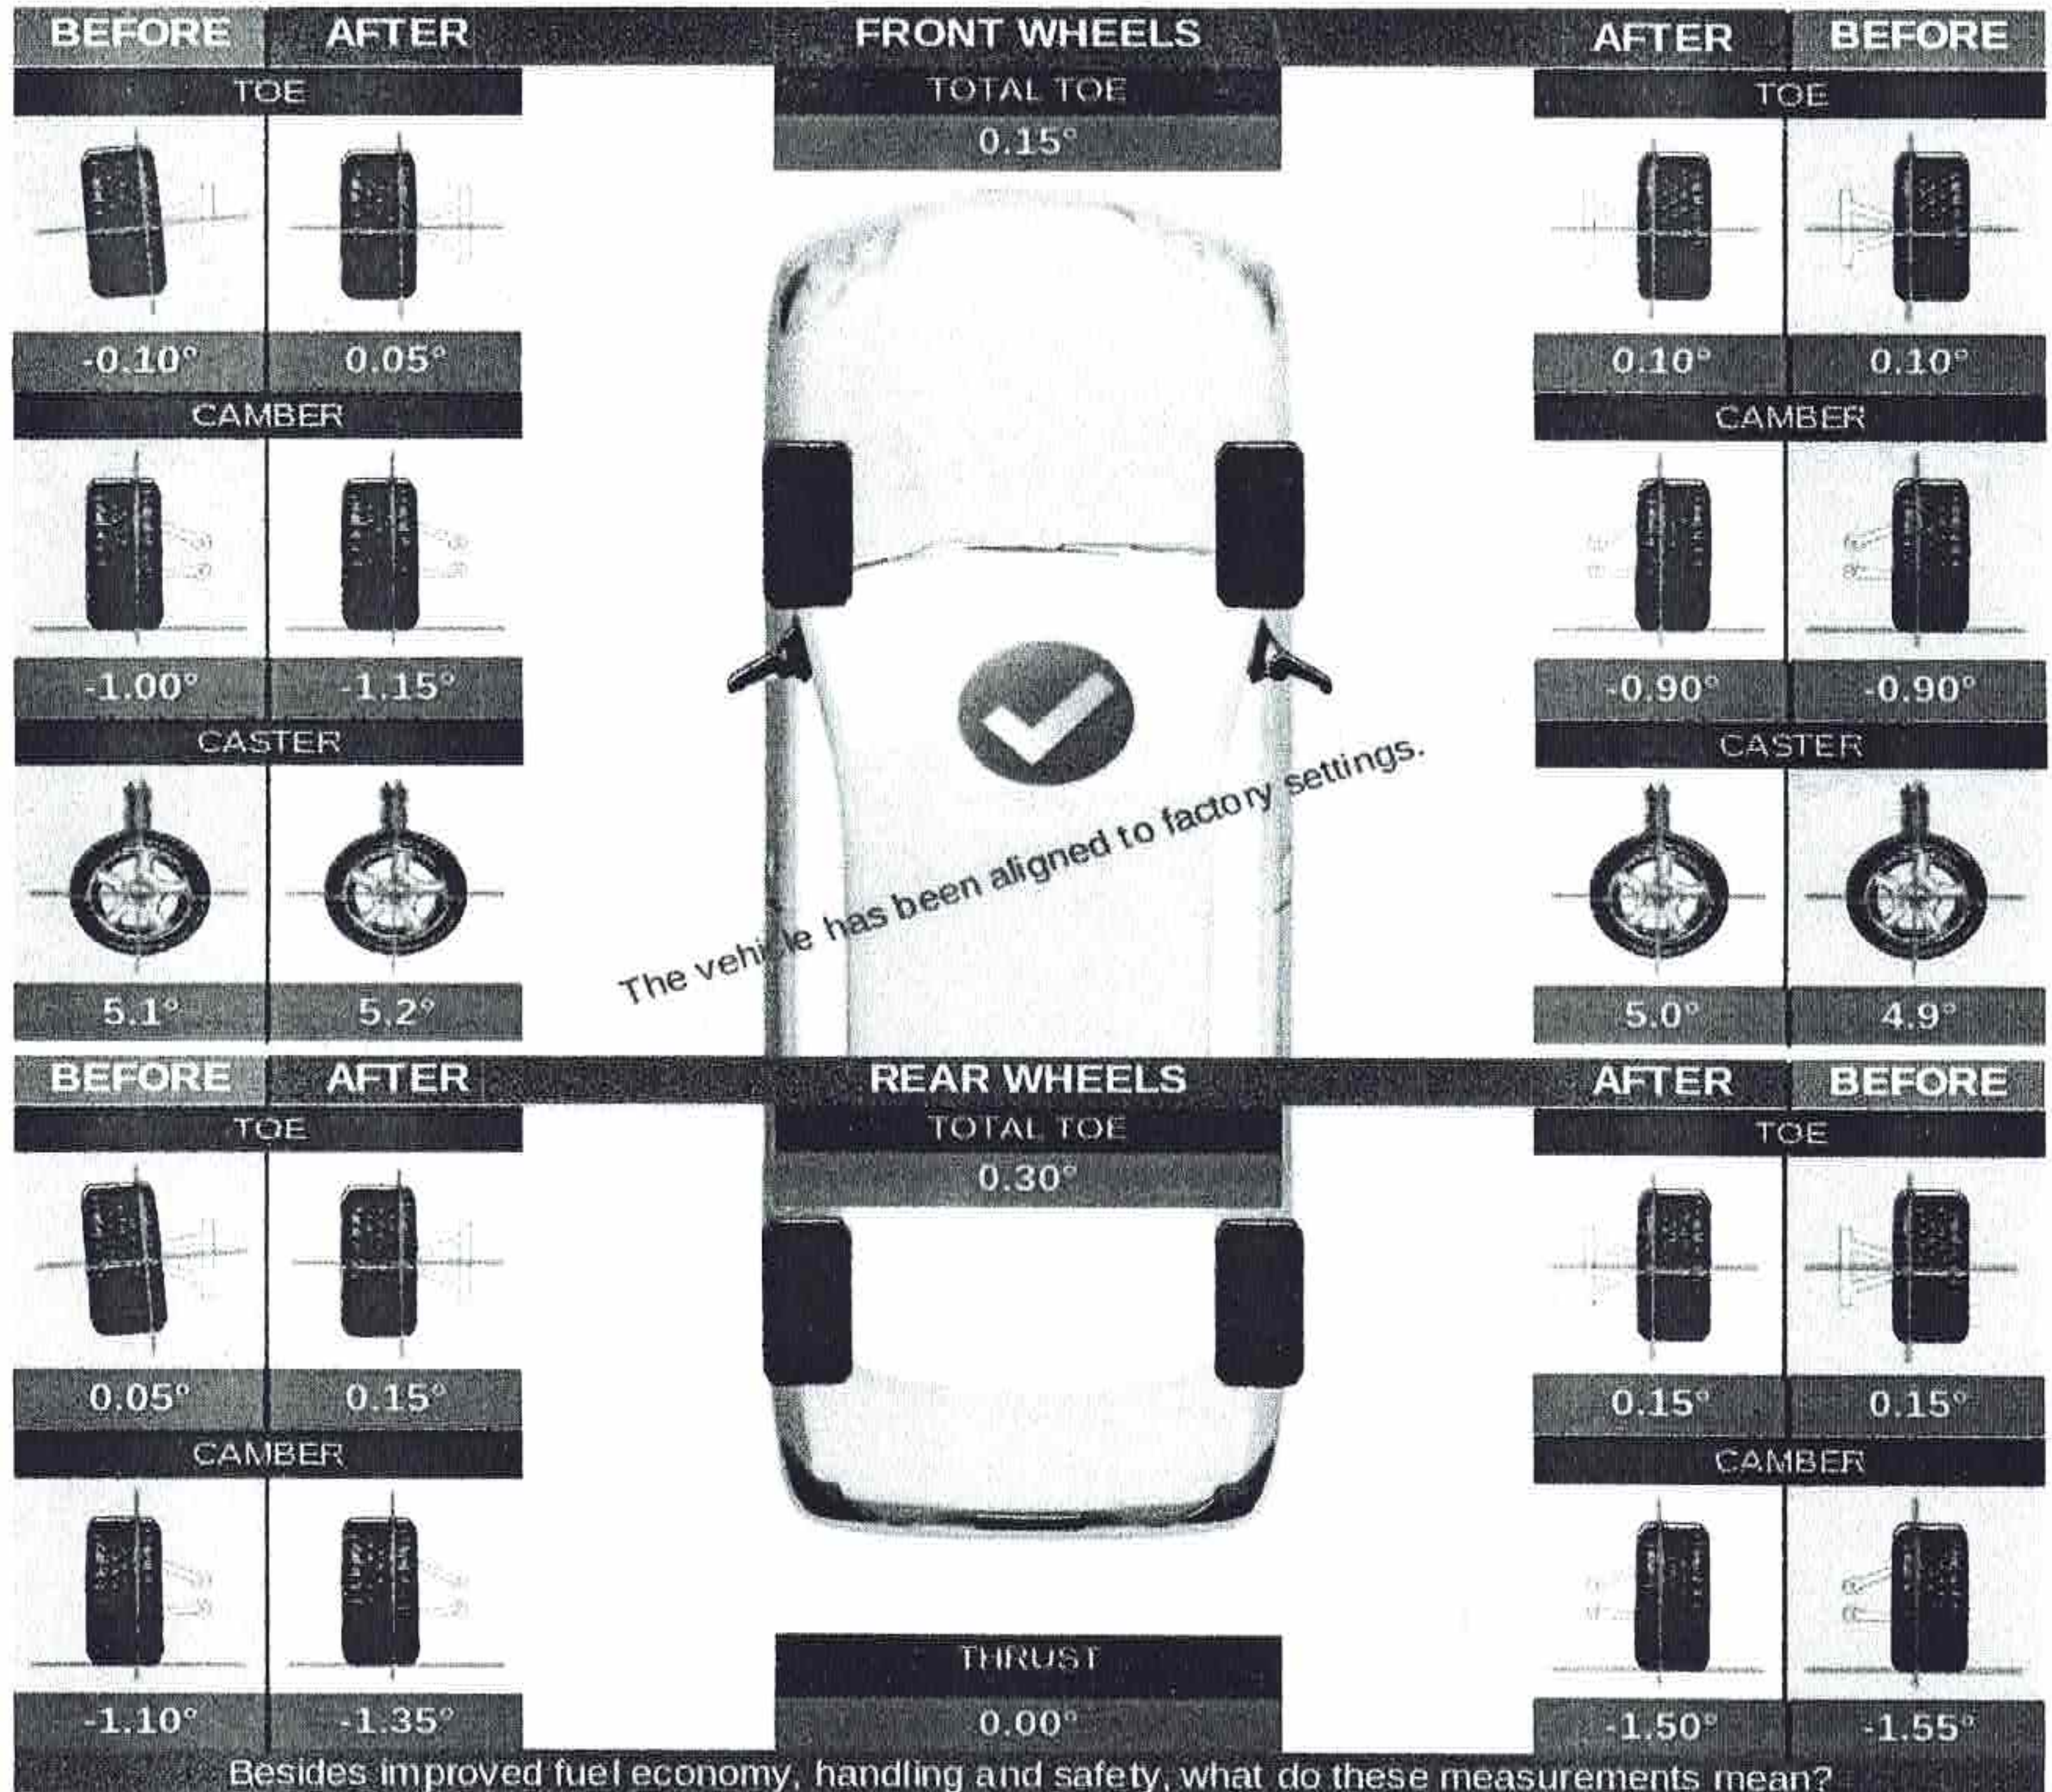

 CASTER is the tilt of the axis that the wheel steers around. It affects how the vehicle tracks as you drive down the road and can affect handling.

 CAMBER is the angle of the tire in relation to the road surface. It affects tire wear, and handling when turning.

 TOE is a measurement of how much the wheel is turned in or out from a straight-ahead position. It affects tire wear, handling and can make your steering wheel crooked.

Your vehicle has been aligned using a precision **JohnBean** wheel aligner.

5.5.0, United States Domestic, US2025R2